

Manhole Inspection Summary

Manhole # S01WW1016MH

Printed On: 12/17/2008

Page 1 of 3

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **01WW1** Node: **016** Status: **Found**

Insp Date: **10/24/08 1:04 PM**

Incomplete Comments

Crew: **REI2**
Inspector: **Hale, C**
Firm: **RKK**

Location Address: **6101 PARKINGTON AVE** Cross Street: **BILTMORE AVE**

Manhole Type: **Inline** Location: **Roadway** Ground Conditions: **Dry**
☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments **Cover Stuck; OPENED BUT MANHOLE IS SURCHARGED 5/7; revisited by jc, ch 6/4/07 revised record to show as CNO
ORIGINAL INSPECTION BY RK&K CREW: CH, IJ 07/28/2006 09:32 AM
COMPLETED BY REI/DRAYCO
LITE CLEANING TO REMOVE DEBRIS FROM CHANNEL**

Cover Shape: **Circular** Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **1** (in.)
Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**
Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **3** (in.) Condition: ☐ Sound ☐ Cracked ☒ **Leaks**

Chimney / Frame Adjustment ☒ Exists Material: **Brick** ☐ Parged Height: **9** (in.)
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated
Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated
Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel Material: **Brick** ☐ Parged
Shape: **Circular** Diameter: **42** (in.) Length: (in.)
Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**
Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☒ **Wall**

Bench ☒ Exists Material: **Brick** ☐ Parged ☒ **Debris** (not Condition related)
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick** ☐ Parged ☐ Debris (not Condition related)
Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps Count: **4** Missing: **0** ☒ **Corroded**

Surcharge ☒ **Evidence Of Surcharge** Depth: **3** (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S01WW1016MH

Printed On: 12/17/2008

Page 2 of 3

Location View



Top View



Surcharge - 1st visit.

Top View



Corroded steps. Evidence of surcharge - Bench debris.

Defect



Frame leaks. Frame offset. Adjustment infiltration.

Defect



Above grade.


Manhole Inspection Summary

Manhole # S01WW1016MH

Printed On: 12/17/2008

Page 3 of 3

8 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock

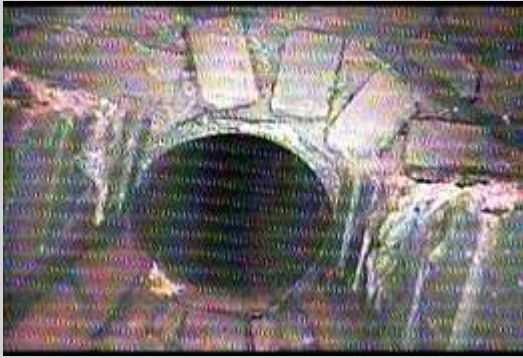

Barrel deterioration and infiltration.

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **9.65** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Cracked**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer Pipe In @ 6 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **8.50** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Broken**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection